

# Report on test step RAB problems - v120

produced on: 02/05/2002 12:54:22

page 1 of 1

Nr. of error report	Test step name	Version	Problem	Comment from MCC Task 160	Done date
<b>020019</b>					
	ts_2DCH_ModifyConvUnknown	v1.2.0	c_PowerOffsetInfoHigher64k should be used	Accepted - v121 - done - Object name: ca_2_DCH_0To3_DL_Info	04/04/2002
	ts_RB_SendRB_SetUp_ConvUnknown_32 k_40	v1.2.0	rateMatchingAttribute 172 should be 187 (165-210)	Accepted - v121 - done - Object name: c_DCH_640_TFS_40_2_UE	04/04/2002
	ts_RB_SendRB_SetUp_ConvUnknown_32 k_40	v1.2.0	c_PowerOffsetInfoHigher64k should be used	Accepted - v121 - done - Object name: c_TrChInfoDL_2_0To3	04/04/2002
	ts_RB_SendRB_SetUp_ConvUnknown_64 k_40	v1.2.0	c_PowerOffsetInfoHigher64k should be used	Accepted - v121 - done - Object name: c_UL_CommTrChInfoTM_0To3	04/04/2002
	ts_RB_SendRB_SetUp_Speech_10_2k	v1.2.0	According to 34108 the RLC Size should be configured instead of all Size	Accepted - v121 - done - Object name: c_RAB_InfoListTM_10_2k	04/04/2002
	ts_RB_SendRB_SetUp_Speech_5_15k	v1.2.0	According to 34108 the RLC Size should be configured instead of all Size	Accepted - v121 - done - Object name: c_RAB_InfoListTM_2	04/04/2002
	ts_RB_SendRB_SetUp_Speech_5_9k	v1.2.0	uses rateMatchingAttribute 170 instead of 190(170- 210)	Accepted - v121 - done - Object name: c_DCH_63_TFS_Msg	04/04/2002

This report contains:

Number of problems: 7

Completed problems: 7